


## Single Trip Alarm (v4) STA138

### DESCRIPTION


The SINGLE TRIP ALARM STA138 is a alarm relay suitable for standard process signals and common sensor types. The alarm directly accepts DC voltage or current input signals (0.1V up to 2kV, 0.1mA up to 2A) while low-level sensor or AC input signals require a factory fitted input-conditioning card. Special requirements for input response time can be accommodated by using the customised response option. The trip circuit is operated from the pre-conditioned input circuit. The trip-point is adjusted by the 15-turn trim potentiometer from the front of the module. Trip status is indicated by a red L.E.D. The action of trip operation, e.g. high or low alarm is internally selectable by a coding plug. The standard output configuration provides a changeover contact output rated at 8A/250Vac. An optional second 8A/250Vac contact is available as change over for all 2-wire inputs and normally open for 3-wire inputs. Dead band is adjustable from 0.5 to 30% via a front accessible trim pot. Various power supply choices are available ranging from 240Vac down to 8Vdc, all contain a dual output for power isolation. Surge protection for power supply and input is standard with all Series 100 modules.

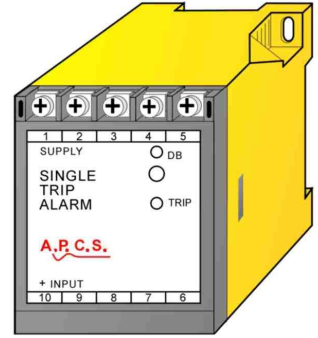


### General Specifications

Size:	52 W x 70 H x 110 D (mm).
Housing material:	Polycarbonate.
Mounting:	DIN-Rail, gear plate.
Termination:	Screw terminals
Weight:	0.300 kg.
Protection class:	IP40 (IP65 Enclosure opt.).
Operating temp. range:	-10...+60°C.
Storage temp. range:	-20...+70°C.
Repeatability:	0.1% of range.
Temperature drift of trippoint:	0.01% / °C.
Relay contact:	Change-over 8A/250Vac resistive 3.5A/250Vac inductive.
Contact isolation:	2kV.
Auxiliary supply output:	24Vdc, 25mA max.
Dead band:	0.5% to 30%
Power requirements:	ac supply 4W, dc supply 3W.
Electromagnetic compatibility:	AS/NZS 4251.1 (EN 50081.1)

### Connections

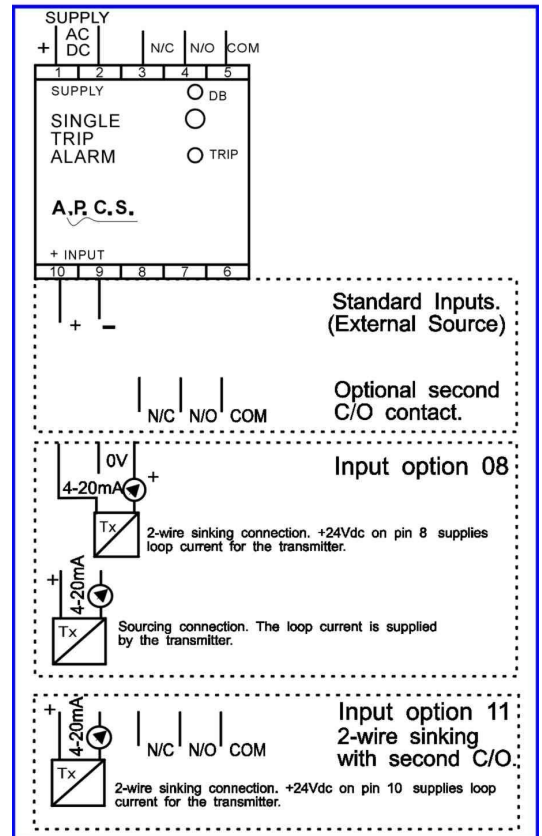

### Block Diagrams

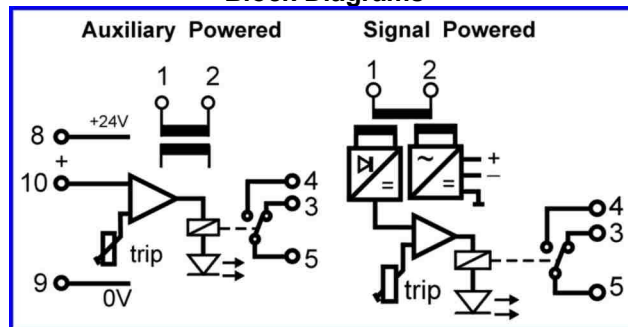

For input / output combinations refer to TYPE NO. DESIGNATION overleaf.

### Power Supply:

- 0 = Signal powered (see inputs).
- 1 = 240V, 50/60Hz  $\pm 10\%$ .
- 2 = 120V, 50/60Hz  $\pm 10\%$ .
- 3 = 24V, 50/60Hz  $\pm 10\%$ .

- \*) 4 = 8 - 60Vdc Isolated
- \*) 8 = 60 - 240Vdc Isolated.
- \*) 9 = Other (Specify).

### Input:

- 01 = 0 - 0.1V (100k)
- 02 = 0 - 1V (100k).
- 03 = 0 - 2V (100k).
- 04 = 0 - 5V (200k).
- 05 = 0 - 10V (500k).
- 06 = 0 - 1mA (1k).
- 07 = 0 - 10mA (100R).
- # 08 = 0 - 20mA, 4 - 20mA (100R).
- \*) 09 = Other signal specify.
- 10 = Optional input, see options below.
- ▶ 11 = 4 - 20mA. (2-wire +24V on pin10).
- ▶ 12 = 4 - 20mA (externally sourced).
- 20 = 80 - 160Vac (signal power).
- 21 = 180 - 260Vac (signal power).
- \*) 22 = 8 - 60Vdc (signal power).
- \*) 23 = 60 - 160Vdc (signal power).
- \*) 29 = Other signal power specify.

### Contact Configuration:

- 1 = Dir (High) C/O (8A/250Vac resistive).
- 2 = Rev (Low) C/O (8A/250Vac resistive).
- \*) ▶3 = Dir (High) 2nd contact (8A/250Vac resistive).
- \*) ▶4 = Rev (Low) 2nd contact (8A/250Vac resistive).
- \*) 5 = Dir N/O solid state relay (2A/70-260Vac).
- \*) 6 = Rev N/O solid state relay (2A/70-260Vac).
- \*) 9 = Other (Specify).

### Options:

#### NOTE:- Specify type of sensor and calibration details.

- 00 = None.
- \*) 01 = Thermocouple input.
- \*) 02 = RTD input.
- \*) 03 = Frequency input: Calibration range 0-10Hz... 0-5kHz (Sine, Triangle). Sensitivity: 200mVpp. (70mV r.m.s.) min. 22Vpp. max. (Square, Pulse).
- \*) 04 = Pulse from proximity sensor or passive device. (Specify:- Auxiliary supply (8 to 24Vdc), Calibration range (0-10Hz...0-5kHz), Device (NAMUR, Contact, NPN, PNP).
- \*) 05 = AC input (current via external shunt).
- \*) 06 = Bipolar / millivolt input. ( $\pm 0.5\text{mV}$  to  $\pm 2\text{kV}$  bipolar) (1mV to 2kV unipolar). It may be more cost effective to use an alternate range.
- \*) 07 = Resistance input (constant current excitation).
- \*) 08 = Customised response time.
- \*) 09 = pH/Electrochemical sensor input.
- \*) 10 = Adder or Subtractor 2 inputs, 4 - 20mA floating.
- \*) 12 = True r.m.s. (any wave form).
- \*) 13 = AC current (internal CT).
- \*) 14 = Conductivity (50mS/cm to 100mS/cm [K=1]).
- \*) 15 = Dissolved oxygen input.
- \*) 16 = Vibration piezo transducer.
- \*) 17 = Load cell input.
- \*) 18 = pH/ORP with Pt100 Temp Comp.
- \*) 33 = External APCS current transformer, specify one ('ECT003' 25A, 'CT004' 100A, 'CCT005' 100A Clamp, 'SCT006' 100A Split Core). and scaling. External CT's are ordered separately.
- \*) 42 = Potentiometer 3W voltage excited.
- \*) 50 = Time delay (Specify:- Time: 0.5 to 10Sec, Function: ON, OFF or POWER ON).
- \*) 99 = Other (Specify).

### Notes

- # = Includes 24Vdc/25mA auxiliary supply on terminal 8.
- ▶ = Order input 11 or 12 when a 20mA input and two change over contacts are required
- ▶ = Second contact is supplied as C/O for 2-wire inputs and N/O for 3-wire inputs.
- \*) = Price Extra.

In the interest of development and improvement, A.P.C.S. Pty. Ltd. reserve the right to amend, without notice, details contained in this publication. A.P.C.S. PTY. LTD. will accept no legal liability for any errors, omissions or amendments.